



EMERSONTM

**Original Instructions
4000858 - REV. 01**

The screenshot shows the configuration interface for the DCX RM S. The top navigation bar includes: IP Setup, Weld Preset, IC Diagnostics, Seek & Weld Graphs, Horn Signature, System Information, and Alarm Log. The main content area is organized into several panels:

- MODE:** Radio buttons for Continuous, Time(a) (0.200), and Energy(J) (1.0).
- PEAK POWER WINDOW:** Radio buttons for Off and On. Checkboxes for -Power(%) (20) and +Power(%) (80).
- WELD:** Amplitude section with Weld Amplitude (%) (80) and Amplitude Ramp (ms) (80). External checkbox is unchecked. Frequency section with Digital Tune (Hz) (30000) and Internal Offset (Hz) (0). Checkboxes for End of Weld Store, Clear memory with Reset, Clear memory before Seek, and Set with Horn Scan.
- SEEK:** Input fields for Seek Ramp (ms) (80), Seek Time (ms) (500), and Frequency Offset (Hz) (0). Timed Seek checkbox is unchecked.
- POWER ON:** Radio buttons for Off, Seek, and Scan. Clear Memory checkbox is checked.
- MISC SETUP:** Checkboxes for Alarms - Reset Required and Start Input - Handheld.

Buttons at the bottom: Save, Cancel, Restore Defaults.

DCX RM S Web Page

Operating Manual

Branson Ultrasonics Corp.
120 Park Ridge Road
Brookfield, CT 06804
(203) 796-0400
<http://www.bransonultrasonics.com>

BRANSON

Manual Change Information

At Branson, we strive to maintain our position as the leader in ultrasonics plastics joining, metal welding, cleaning and related technologies by continually improving our circuits and components in our equipment. These improvements are incorporated as soon as they are developed and thoroughly tested.

Information concerning any improvements will be added to the appropriate technical documentation at its next revision and printing. Therefore, when requesting service assistance for specific units, note the Revision information found on this document, and refer to the printing date which appears on this page.

Copyright and Trademark Notice

Copyright © 2026 Branson Ultrasonics Corporation. All rights reserved. Contents of this publication may not be reproduced in any form without the written permission of Branson Ultrasonics Corporation.

Mylar is a registered trademark of DuPont Teijin Films.

Loctite is a registered trademark of Loctite Corporation.

WD-40 is a registered trademark of WD-40 Company.

Windows 10, Windows 11, and Microsoft Edge are registered trademarks of Microsoft Corporation.

Google Chrome is a trademark of Google LLC.

Other trademarks and service marks mentioned herein are held by their respective owners.

Foreword

Congratulations on your choice of a Branson Ultrasonics Corporation system!

The Branson DCX RM S Power Supply system is process equipment for the joining of plastic parts using ultrasonic energy. It is the newest generation of product using this sophisticated technology for a variety of customer applications. This Operating Manual is part of the documentation set for this system, and should be kept with the equipment.

Thank you for choosing Branson!

Introduction

This manual is arranged into several structured chapters which will help you find the information you may need to know to safely handle, install, set up, program, operate, and/or maintain this product. Please refer to the [Table of Contents](#) and/or the [Index](#) of this manual to find the information you may be looking for. In the event you require additional assistance or information, please contact our Product Support department (see [1.3 How to Contact Branson](#) for information on how to contact them) or your local Branson representative.



Table of Contents

Chapter 1: Safety and Support

1.1	Safety Requirements and Warnings	2
1.2	General Precautions.	4
1.3	How to Contact Branson.	6

Chapter 2: Introduction

2.1	Introduction	8
2.2	Models Covered	9

Chapter 3: Connecting to the Web Page Interface

3.1	Locating the Ethernet Port	12
3.2	System Requirements	13
3.3	Point to Point Connection (Windows 10 or Windows 11).	14

Chapter 4: The Web Page Interface

4.1	Web Page Interface Overview	18
4.2	Login	19
4.3	IP Setup.	20
4.4	Weld Preset	22
4.5	I/O Diagnostics	25
4.6	Seek & Weld Graphs	26
4.7	Horn Signature	28
4.8	System Information.	30
4.9	Alarm Log	31

Appendix A: Manual's Revisions

A.1	Manual's Revisions	34
-----	------------------------------	----



List of Figures

Chapter 1: Safety and Support

Chapter 2: Introduction

Chapter 3: Connecting to the Web Page Interface

Figure 3.1 DCX RM S Power Supply.12

Chapter 4: The Web Page Interface

Figure 4.1 Web Page Interface Overview18

Figure 4.2 Login19

Figure 4.3 IP Setup Menu20

Figure 4.4 Weld Preset Menu22

Figure 4.5 I/O Diagnostics Menu.25

Figure 4.6 Seek & Weld Graphs Menu26

Figure 4.7 Horn Signature Menu.28

Figure 4.8 System Information Menu30

Figure 4.9 Alarm Log Menu31

Appendix A: Manual's Revisions

Figure A.1 Manufacturing date on the Information label.34

Figure A.2 Location of the Information label on the back of the DCX RM S Power Supply.35



List of Tables

Chapter 1: Safety and Support**Chapter 2: Introduction****Chapter 3: Connecting to the Web Page Interface****Chapter 4: The Web Page Interface**

Table 4.1	Web Page Interface Overview	18
Table 4.2	IP Setup Menu Option	20
Table 4.3	Weld Preset Menu Option	22
Table 4.4	I/O Diagnostics Menu Option	25
Table 4.5	Seek & Weld Graphs Menu Option	27
Table 4.6	Horn Signature Menu Option	29
Table 4.7	System Information Menu Option	30
Table 4.8	Alarm Log Menu Option	31

Appendix A: Manual's Revisions

Table A.1	Manual's Revisions	34
-----------	------------------------------	----

Chapter 1: Safety and Support





1.1 Safety Requirements and Warnings 2
1.2 General Precautions 4
1.3 How to Contact Branson 6




1.1 Safety Requirements and Warnings

This chapter contains an explanation of the different safety notice symbols and icons found in this manual and provides additional safety information for ultrasonic welding. This chapter also describes how to contact Branson for assistance.

1.1.1 Symbols Found in this Manual

These symbols used throughout this manual warrant special attention:


WARNING	Indicates a possible danger
	If these risks are not avoided, death or severe injury might result.
WARNING	High Voltage Hazard
	High voltage. Turn power off before servicing.
WARNING	Corrosive Material Hazard
	Corrosive material. Avoid contact with eyes and skin. Wear proper protection.
CAUTION	Indicates a possible danger
	If these risks are not avoided, slight or minor injury might result.


CAUTION	Loud Noise Hazard
	Loud noise hazard. Ear protection must be worn.
CAUTION	Heavy Object
	Heavy object. To avoid muscle strain or back injury, use lifting aids and proper lifting techniques.
NOTICE	Indicates a possible damaging situation
	<p>If this situation is not avoided, the system or something in its vicinity might get damaged.</p> <p>Application types and other important or useful information are emphasized.</p>


1.2 General Precautions

Take the following precautions before servicing the power supply:

- Be sure the power is disconnected before making any electrical connections
- To prevent the possibility of an electrical shock, always plug the power supply into a grounded power source
- Power supplies produce high voltage. Before working on the power supply assembly, do the following:
 - Turn off the power supply
 - Unplug main power
 - Allow at least 5 minutes for capacitors to discharge
- High voltage is present in the power supply. Do not operate with the cover removed
- High line voltages exist in the ultrasonic power supply assembly. Common points are tied to circuit reference, not chassis ground. Therefore, use only non-grounded, battery-powered multimeters when testing the power supply assembly. Using other types of test equipment can present a shock hazard
- Keep hands from under the horn. Down force (pressure) and ultrasonic vibrations can cause injury
- Do not cycle the welding system if either the RF cable or converter is disconnected
- When using larger horns, avoid situations where fingers could be pinched between the horn and the fixture

CAUTION	Loud Noise Hazard
	<p>Sound level and frequency of the noise emitted during the ultrasonic assembly process may depend upon a. type of application, b. size, shape and composition of the material being assembled, c. shape and material of the holding fixture, d. welder setup parameters and e. tool design.</p> <p>Some parts vibrate at an audible frequency during the process. Some or all of these factors may result in an uncomfortable noise being emitted during the process.</p> <p>In such cases operators may need to be provided with personal protective equipment. See 29 CFR (Code of Federal Regulations) 1910.95 Occupational Noise Exposure</p>

NOTICE	
	<p>When the battery is worn out, dispose it under the ordinance of each local government.</p>

WARNING	Corrosive Material Hazard
	<p>First aid measures (in case of electrolyte leakage from the battery)</p> <p>Eye Contact: Flush the eyes with plenty of clean water for at least 15 minutes immediately, without rubbing. Get immediate medical treatment. If appropriate procedures are not taken, this may cause eye injury.</p> <p>Skin Contact: Wash the affected area under tepid running water using a mild soap. If appropriate procedures are not taken, this may cause sores on the skin. Get medical attention if irritation develops or persists.</p> <p>Inhalation: Remove to fresh air immediately. Get medical treatment immediately.</p>


1.2.1 Intended Use of the System

The DCX Power Supply and components are designed to be used as part of an ultrasonic welding system. These are designed for a wide variety of welding or processing applications.

The system can be used to perform ultrasonic welding, inserting, staking, spot welding, swaging, degating, and continuous ultrasonic operations. It is designed for automated, semi-automated and/or manual production operations.

1.2.2 Emissions

When being processed, certain plastic materials can emit toxic fumes, gases or other emissions that can be hazardous to the operator's health. Where such materials are processed, proper ventilation of the workstation is required. Check your materials suppliers for recommended protection when processing their materials.

WARNING	Corrosive Material Hazard
	<p>Processing of many materials, such as PVC, can be hazardous to an operator's health and could cause corrosion/damage to the equipment. Use proper ventilation and take protective measures.</p>

1.3 How to Contact Branson

For additional assistance, please refer to the DCX RM S Power Supply Instruction Manual.

Chapter 2: Introduction

2.1	Introduction	8
2.2	Models Covered	9

2.1 Introduction

The DCX RM S Web Page Interface provides access, via Ethernet connection, to web pages containing power supply information, diagnostics tools, and configuration options. Communication can be established point-to-point or through a local area network. On the web page interface you can access:

- [4.3 IP Setup](#)
- [4.4 Weld Preset](#)
- [4.5 I/O Diagnostics](#)
- [4.6 Seek & Weld Graphs](#)
- [4.7 Horn Signature](#)
- [4.8 System Information](#)
- [4.9 Alarm Log](#)

2.2 Models Covered

This manual applies to the web page interface of the DCX RM S power supply.

2.2.1 DCX RM S Power Supply Manual Set

The following documentation is available in electronic format for the DCX RM S power supply:

- DCX RM S Power Supply Instruction Manual

Chapter 3: Connecting to the Web Page Interface

3.1	Locating the Ethernet Port	12
3.2	System Requirements	13
3.3	Point to Point Connection (Windows 10 or Windows 11)	14

3.1 Locating the Ethernet Port


3.1.1 DCX RM S Ethernet Port Location


Figure 3.1 DCX RM S Power Supply



3.2 System Requirements

To connect to the DCX Web Page Interface you will need a PC running a Windows^{®1} operating system with a Google Chrome^{™2} or Microsoft Edge^{®1} web browser software.

NOTICE	
	The DCX RM S power supply is not compatible with network scanning software. If your local network uses these types of programs, the DCX RM S IP address must be placed in an exclusion list.


NOTICE	
	A shielded Ethernet cable should be used to connect to the DCX RM S Web Page Interface to prevent possible EMI (Electromagnetic Interference) issues.

1. Windows 10, Windows 11, and Microsoft Edge are registered trademarks of Microsoft Corporation.
2. Google Chrome is a trademark of Google LLC.


3.3 Point to Point Connection (Windows 10 or Windows 11)

To connect directly to the DCX Power Supply Web Page Interface using a PC with Windows 10^{®1} or Windows 11^{®1} operating system, complete the following steps:


1. Connect the power supply to a computer via the Ethernet port
2. Turn on the power supply
3. On your PC, click the Start button on the taskbar and search for the **Control Panel**
4. Select **View Large Icons** on the top right corner
5. Select **Network and Sharing Center**
6. Select **Change adapter settings**

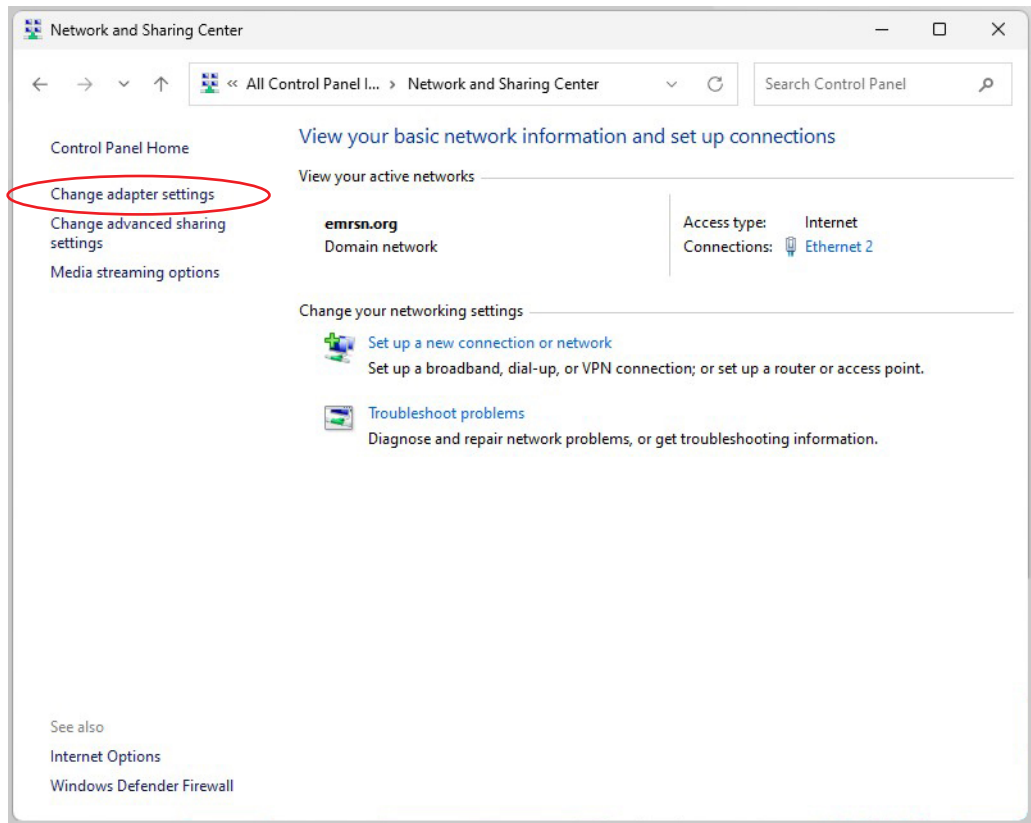

7. Right click on **Ethernet 2** and select **Properties** to bring up the **Networking** tab

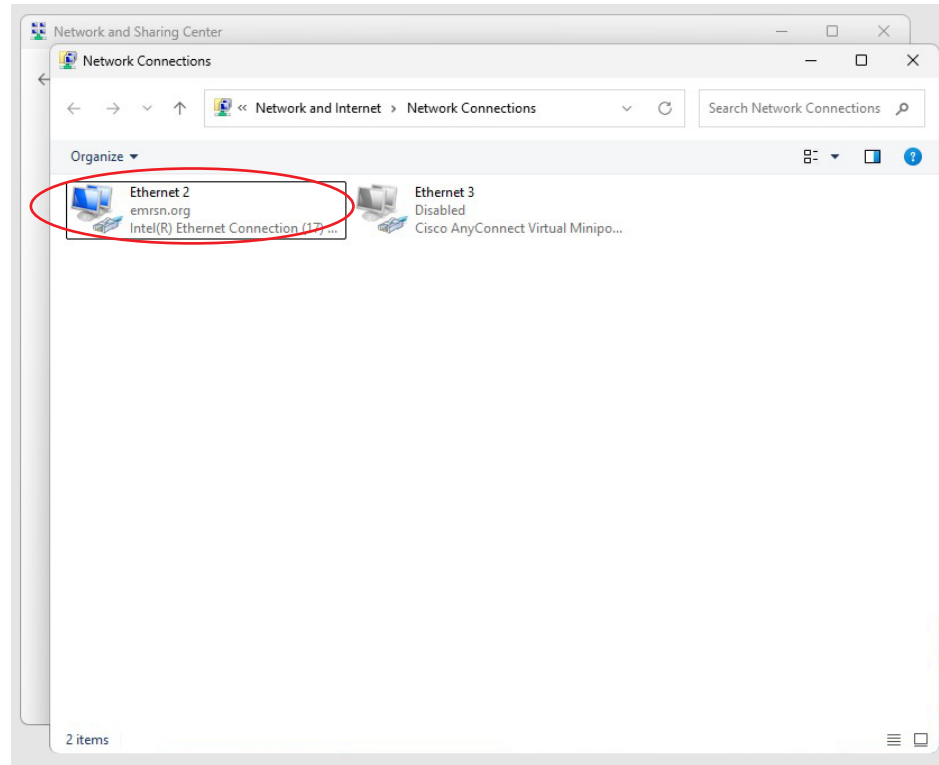


8. Highlight **Internet Protocol Version 4 (TCP/IPv4)** from the list and click on **Properties**

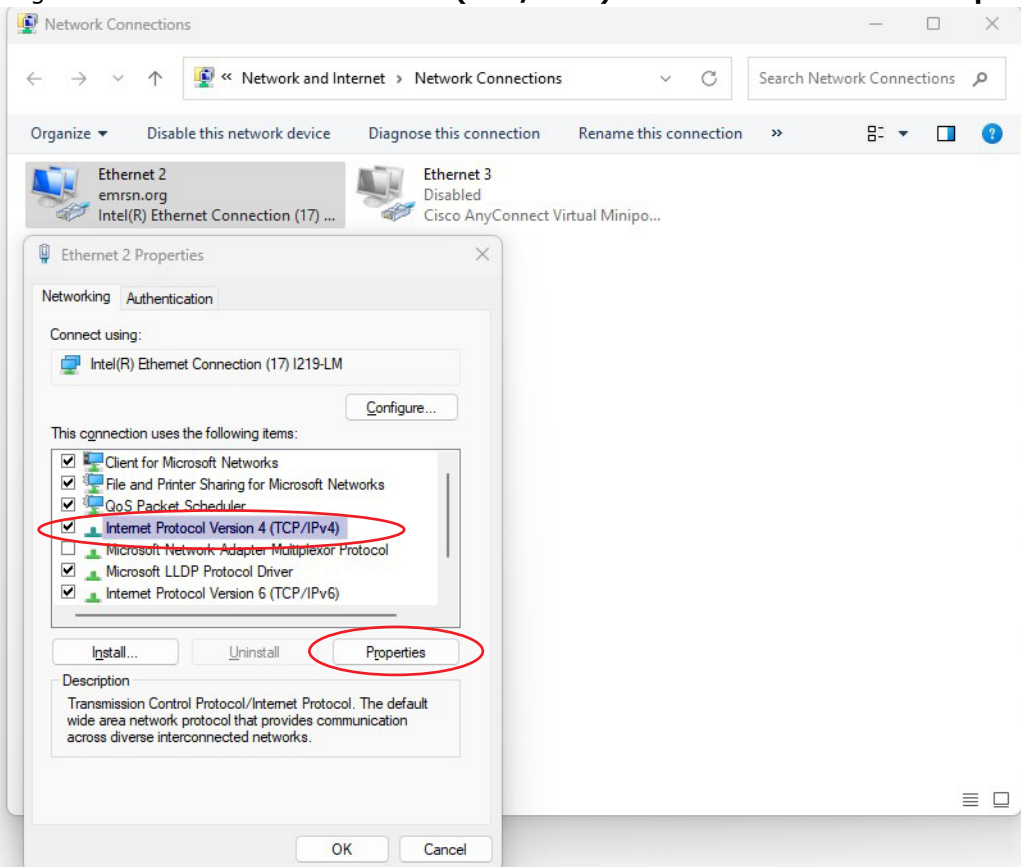

9. Use the following IP address:

IP address: 192.168.10.101

Subnet mask: 255.255.255.0

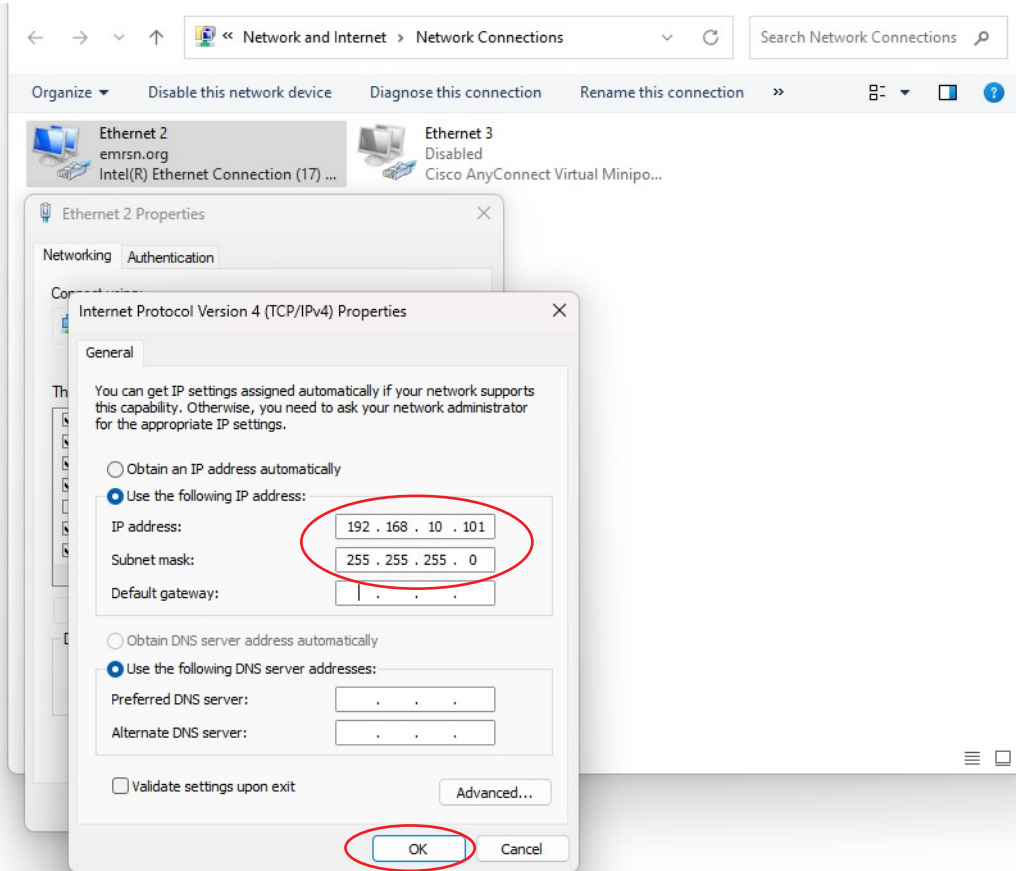


10. Click **OK**. Close the rest of the dialog boxes

11. Open the Google Chrome™² or Microsoft Edge®¹ web browser

12. In the address bar type the following address: <http://192.168.10.100>. Press **Enter**

13. This will bring up the DCX RM S Web Page Interface

14. Enter a user ID number (any number up to 9 digits long)

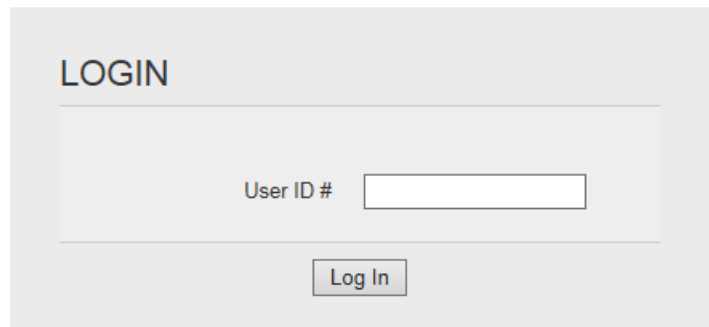

Chapter 4: The Web Page Interface

4.1	Web Page Interface Overview	18
4.2	Login	19
4.3	IP Setup	20
4.4	Weld Preset	22
4.5	I/O Diagnostics	25
4.6	Seek & Weld Graphs	26
4.7	Horn Signature	28
4.8	System Information	30
4.9	Alarm Log	31

4.1 Web Page Interface Overview

The DCX RM S Web Page Interface allows you to set a weld preset, diagnose and configure the power supply I/O, perform horn scans and seeks, view system information, and to view and download the system alarms, history and events logs.

Figure 4.1 Web Page Interface Overview

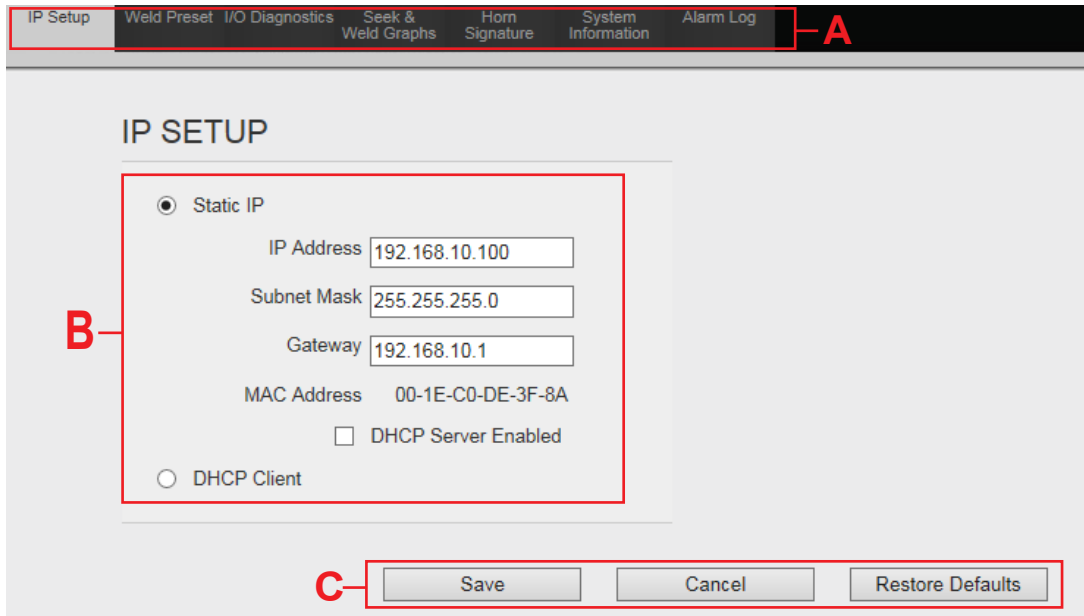



Table 4.1 Web Page Interface Overview

Item	Name	Description
A	Menu Navigation Tabs	The menu navigation tabs are always displayed on the upper section of the web pages. They provide access to the following menu options: 4.3 IP Setup 4.4 Weld Preset 4.5 I/O Diagnostics 4.6 Seek & Weld Graphs 4.7 Horn Signature 4.8 System Information 4.9 Alarm Log
B	Menu Display	Displays the contents of the currently selected menu option.
C	Command Buttons	Different command buttons allow to save settings, cancel changes, restore default settings, and to perform other functions specific to each menu. Save, Cancel, and Restore Defaults is page specific. They only operate on the page displayed.

4.2 Login

When connection is established with the DCX RM S Web Page Interface, the Login page will display. Enter a unique user ID number. The user ID is numeric only and up to 9 digits long. This number allows for keeping track of user access.

Figure 4.2 Login

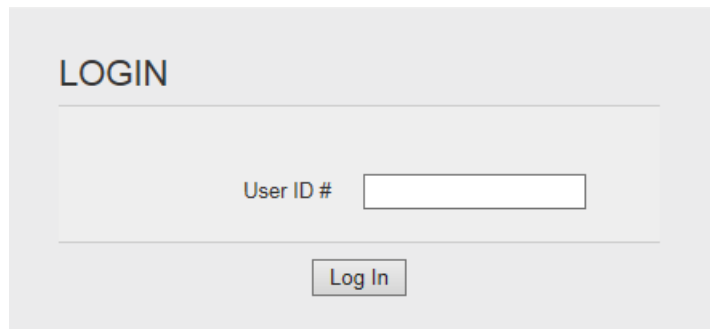

The screenshot shows a login interface with the following elements:

- The word "LOGIN" is displayed at the top left of the form area.
- A horizontal line separates the title from the input field.
- The text "User ID #" is positioned to the left of a rectangular text input field.
- Another horizontal line is located below the input field.
- A "Log In" button is centered below the input field.

4.3 IP Setup

Use this menu to setup the DCX RM S power supply's network settings. DCX RM S power supply's default IP setting is Static IP with the address shown in the figure below.


Figure 4.3 IP Setup Menu

Table 4.2 IP Setup Menu Option


Name	Description
IP SETUP	
Static IP	Select this option to manually assign an IP address to the DCX RM S power supply. The DCX RM S power supply will alert if an invalid IP address setting is entered.
IP Address	The IP address assigned to the DCX RM S power supply.
Subnet Mask	The mask used to determine to what subnet the DCX RM S power supply's address belongs to.
Gateway	The gateway address assigned to the network for communication with other computers or networks.
MAC Address	Displays the MAC address assigned to the DCX RM S power supply.
DHCP Server Enabled	Select this option to have DCX RM S power supply assign IP addresses to any devices connected to it. This facilitates connecting a computer or laptop point to point (P2P) with the DCX RM S power supply. NOTICE Connecting a DCX RM S power supply with DHCP server enabled to a network which already has a device working as a DHCP server will cause connectivity problems.

Table 4.2 IP Setup Menu Option

Name	Description
DHCP Client	Select this option to have the DCX RM S power supply automatically request an IP address from a DHCP Server. The IP address will be grayed out.

NOTICE	
	All changes on this menu take effect on the next power-up.

At any time you may determine the DCX RM S power supply's IP address by going through the associated registers using the front panel LCD. A Cold Start can also be performed to take your power supply back to its factory default IP address. For details on navigating the DCX RM S registers or performing a Cold Start, consult your power supply manual.

NOTICE	
	Beware that other settings will also be reset to their defaults when a Cold Start is executed.

4.4 Weld Preset

Use this menu to set weld parameters, seek options, and power-up actions. Use the command buttons on the bottom to save settings, cancel changes, or to restore to factory default settings.

Figure 4.4 Weld Preset Menu

The screenshot shows the 'Weld Preset' menu with the following settings:

- MODE:** Radio buttons for Continuous, Time(s) (0.200), and Energy(J) (1.0). Time(s) is selected.
- PEAK POWER WINDOW:** Radio buttons for Off and On. On is selected. Checkboxes for -Power(%) (20) and +Power(%) (80) are checked.
- WELD:**
 - Amplitude:** Weld Amplitude (%) (80), Amplitude Ramp (ms) (80). External checkbox is unchecked.
 - Frequency:** Digital Tune (Hz) (30000), Internal Offset (Hz) (0). End of Weld Store, Clear memory with Reset, and Clear memory before Seek checkboxes are checked. Set with Horn Scan checkbox is unchecked.
- SEEK:** Seek Ramp (ms) (80), Seek Time (ms) (500), Frequency Offset (Hz) (0). Timed Seek checkbox is unchecked.
- POWER ON:** Radio buttons for Off, Seek, and Scan. Seek is selected. Clear Memory checkbox is checked.
- MISC SETUP:** Alarms - Reset Required checkbox is checked. Start Input - Handheld checkbox is unchecked.

Buttons at the bottom: Save, Cancel, Restore Defaults.

Table 4.3 Weld Preset Menu Option

Name	Description
Mode	
Continuous	Weld mode changes to Continuous after pressing save button.
Time (s)	Weld mode changes to Time after pressing save button.
Energy (J)	Weld mode changes to Energy after pressing save button.
Peak Power Window	
Off	Select this option to disable power window limits.
On	Select this option to enable power window limits.

Table 4.3 Weld Preset Menu Option

Name	Description
-Power (%)	Set the desired power window limit low value. NOTICE Power window limits must be set in multiples of 5.
+Power (%)	Set the desired power window limit high value. NOTICE Power window limits must be set in multiples of 5.
Amplitude	
Weld Amplitude (%)	The amplitude of ultrasonic energy that will be delivered by the DCX RM S power supply. Valid range is between 10 to 100 (10% to 100% amplitude).
Amplitude Ramp (ms)	The time it takes for the amplitude to ramp up to 100% when the External Start signal is applied. If amplitude setting is lower than 100%, ramp time will be adjusted accordingly.
External	Select the External check box to control the amplitude using an analog input from the user I/O connector.
Frequency	
Digital Tune (Hz)	Starting frequency set from horn signature or manually entered.
Internal Offset (Hz)	Sets the frequency offset from the Web Page as either a positive or negative value offset from digital tune.
End of Weld Store	Select to save the frequency at the end of the weld as the starting frequency for the following weld.
Clear memory with Reset	Select to clear memory with reset. Memory offset will be set to 0 when a Reset is applied. Reset can come from external I/O, front panel, or web page interface (seek or horn scan).
Clear Memory before Seek	Select to clear memory before seek. Memory offset will be set to 0 before Seek is applied.
Set with Horn Scan	Select to set Digital Tune frequency with a successfully completed horn scan.
Seek	
Seek Ramp (ms)	The time it will take the power supply to ramp-up when performing a seek.
Seek Time (ms)	The duration of a seek.
Frequency Offset (Hz)	The frequency offset applied to the power supply operating frequency.
Timed Seek	Select this check box to have the power supply perform a seek every 60 seconds. Seeks will be timed from the moment sonics was last activated.
Power On	
Off	Select this option to disable power-on actions.

Table 4.3 Weld Preset Menu Option

Name	Description
Seek	Select this option to have the power supply perform a seek on power-up.
Scan	Select this option to have the power supply perform a horn scan on power-up.
Misc Setup	
Alarms - Reset Required	This option determines if the alarm is latched or not. Latched alarms require a reset before another cycle can start.
Start Input - Handheld	If this option is selected, the user must maintain the start input signal throughout the duration of the weld cycle. If the start input is released during a cycle, then the cycle is aborted.

4.5 I/O Diagnostics

Use this menu to monitor and control the DCX RM S power supply digital and analog I/O.

Figure 4.5 I/O Diagnostics Menu

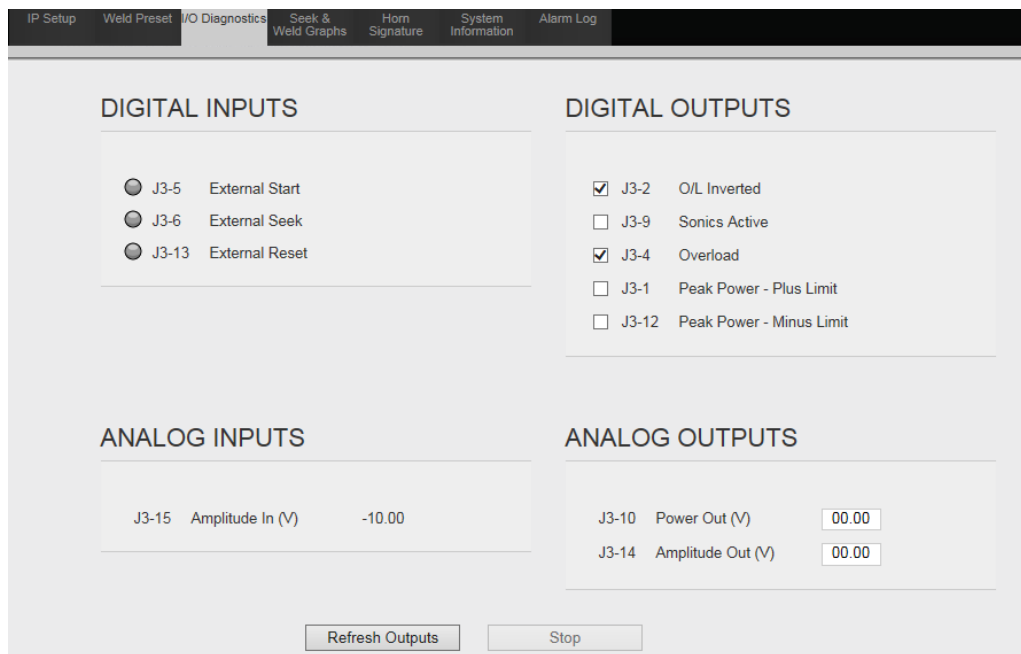


Table 4.4 I/O Diagnostics Menu Option

Name	Description
Digital Inputs	
J3-5 External Start	Indicate if the digital inputs are active.
J3-6 External Seek	
J3-13 External Reset	
Digital Outputs	
J3-2 O/L Inverted	Select/clear check boxes to toggle available digital outputs on/off.
J3-9 Sonics Active	
J3-4 Overload	
J3-1 Peak Power - Plus Limit	
J3-12 Peak Power - Minus Limit	
Analog Inputs	
J3-15 Amplitude In (V)	Displays the current analog input values.
Analog Outputs	
J3-10 Power Out (V)	Allows control of analog output values.
J3-14 Amplitude Out (V)	

4.6 Seek & Weld Graphs

Use this menu to test your system. This feature allows you to capture 5 seconds of welding data which you can both view and export. The weld data graph is provided with 6 available parameters: Amplitude, Power, Phase, PWM Amplitude, Current, and Frequency. Each parameter has a checkbox to the left of its name.

Only checked parameters will be displayed. While in this menu, if the Weld is being run from external I/O or the custom LCD, the graph can be also displayed on the screen by using the "Update Graph" button.

Figure 4.6 Seek & Weld Graphs Menu

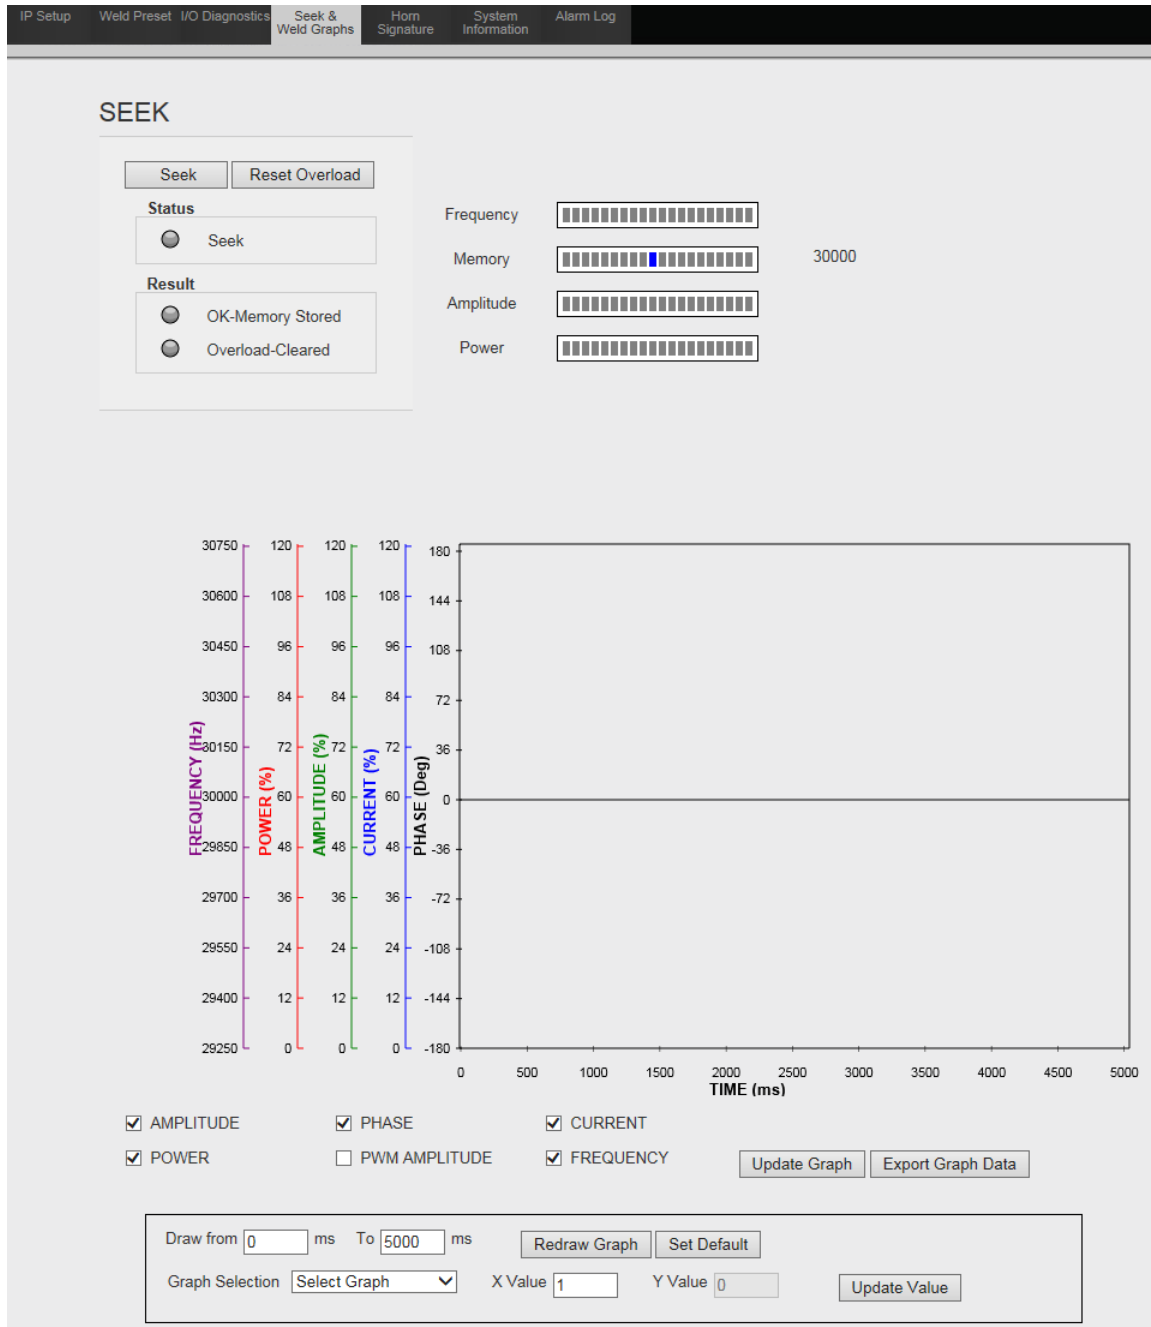


Table 4.5 Seek & Weld Graphs Menu Option

Name	Description
Seek	
Seek	Click to perform a seek cycle.
Reset Overload	Click to reset an overload condition.
OK - Memory Stored	Indicates that the horn operating frequency was stored in the DCX RM S power supply memory.
Overload - Cleared	Indicates that test resulted in an overload and the memory has been cleared.
Frequency	Monitors the horn operating frequency.
Memory	Displays the frequency stored in the DCX RM S power supply memory.
Amplitude	Displays the percentage of converter amplitude.
Power	Displays the percentage of power output.
Update Graph	Click to get the value of all the parameter and draw the graph for Phase, Current, Amplitude, Power, and Frequency parameters vs Time on the Y axis.
Export Graph Data	Click to export the Weld Graph data with Weld Preset settings to CSV file.
Draw from... to...	Select the <i>from</i> and <i>to</i> time values to zoom into the desired graph region.
Redraw Graph	Click to redraw the same graph with those parameters which are checked with the Time parameter on Y axis.
Set Default	Click to return the sample rate, start time, end time and graph selection to default settings.
Graph Selection	Select a parameter and enter a particular X time value to obtain the corresponding Y value at that particular time.
Update Value	Click to update the Y value for the given graph selection.

4.7 Horn Signature

Use this menu to diagnose your ultrasonic horn. When performing a horn scan, ideally, there will be only one resonant frequency. The Horn Signature graph is provided with 3 available parameters: Phase, Current, and Amplitude. The horn Signature Graph can be both viewed and exported.

Each parameter has a checkbox to the left of its name. Only checked parameters will be displayed.

Figure 4.7 Horn Signature Menu

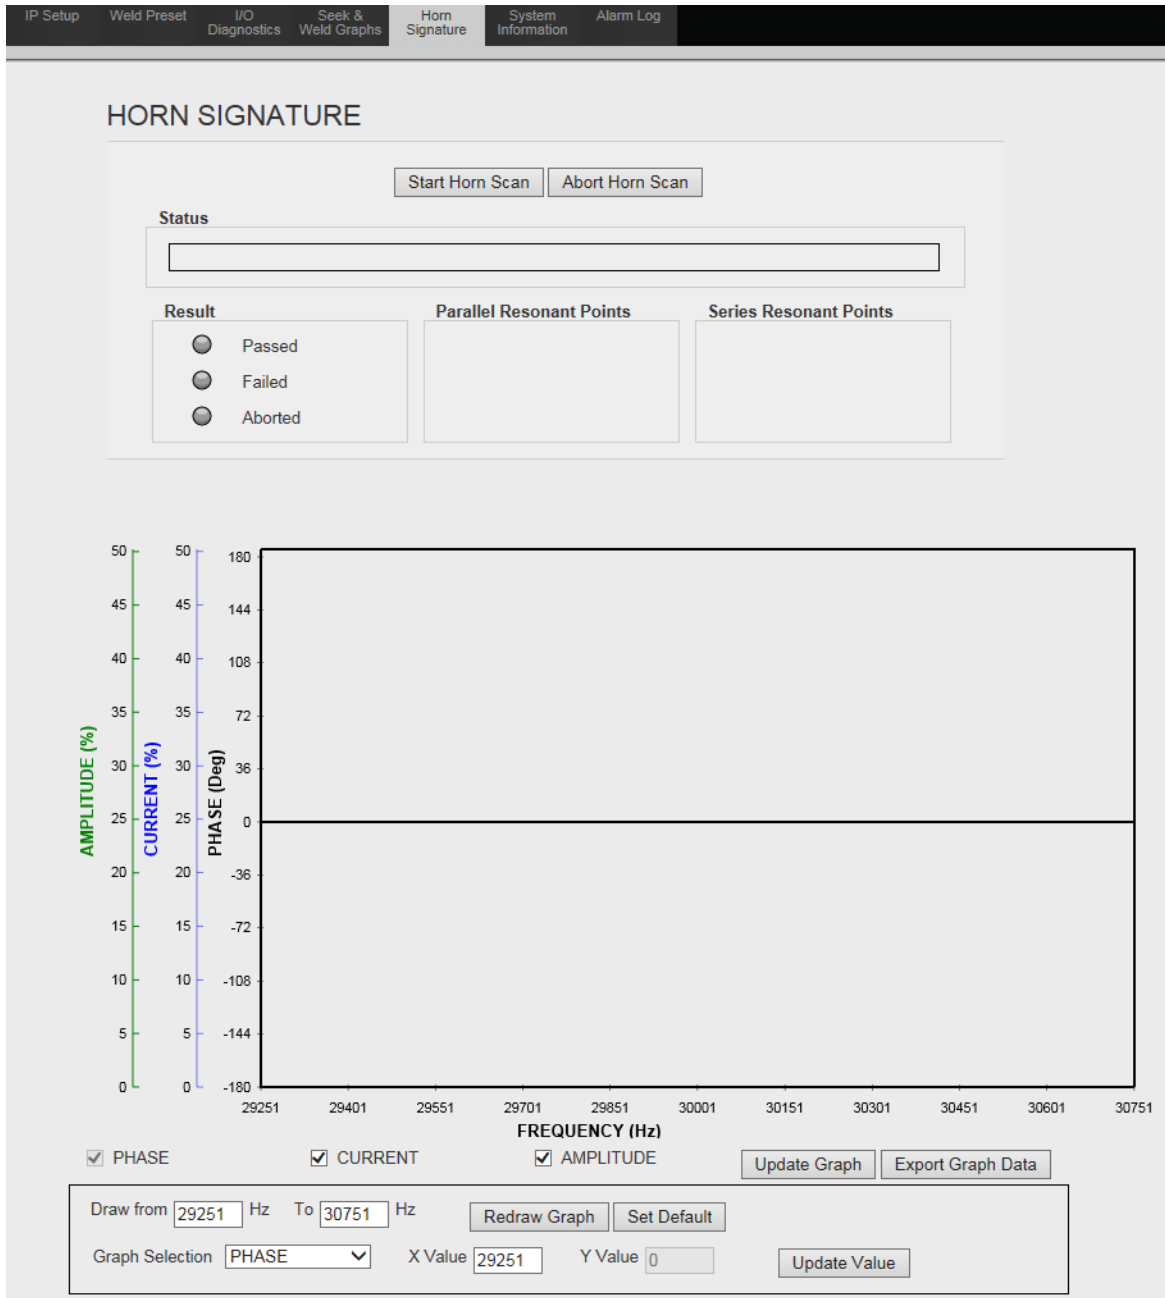


Table 4.6 Horn Signature Menu Option

Name	Description
Horn Signature	
Start Horn Scan	Click to initiate the horn scan.
Abort Horn Scan	Click to abort the horn scan.
Status	Indicates the horn scan progress.
Result	Indicates if the horn scan passed, failed, or if the operation was aborted.
Parallel Resonant Points	<p>Displays the parallel resonant frequencies of the ultrasonic horn. The parallel resonant frequency is the operating frequency of the ultrasonic stack.</p> <p>NOTICE If multiple parallel frequencies are found, they will all be listed. The frequency at which the ultrasonic stack is running will be displayed in blue.</p>
Series Resonant Points	Displays the series resonant frequencies of the ultrasonic horn.
Update Graph	Click to draw the graph of the last horn scan.
Export Graph Data	Click to export the Weld Graph data with Weld Preset settings to CSV file.
Draw from... to...	Select the <i>from</i> and <i>to</i> time values to zoom into the desired graph region.
Redraw Graph	Click to redraw the same graph with those parameters which are checked with the Time parameter on Y axis.
Set Default	Click to return the sample rate, start time, end time and graph selection to default settings.
Graph Selection	Select a parameter and enter a particular X time value to obtain the corresponding Y value at that particular time.
Update Value	Click to update the Y value for the given graph selection.

4.8 System Information

Use this menu to view information about your DCX RM S power supply. Have the information on this screen available when calling Branson for troubleshooting help.

Figure 4.8 System Information Menu

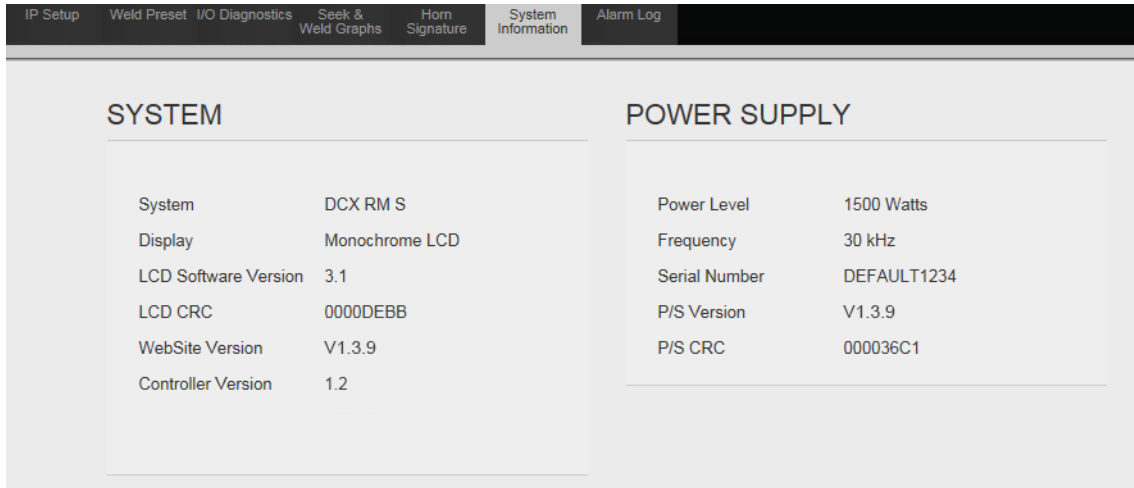


Table 4.7 System Information Menu Option

Name	Description
System	
System	Displays the DCX RM S power supply model name.
Display	Displays the type of front panel user interface on the DCX RM S power supply.
LCD Software Version	Displays the LCD software version number.
LCD CRC	Displays the CRC code of the LCD software.
WebSite Version	Displays the Web Page version number.
Controller Version	Displays the controller version.
Power Supply	
Power Level	Displays the power supply wattage.
Frequency	Displays the power supply operating frequency.
Serial Number	Displays the power supply serial number.
P/S Version	Displays the power supply software version number.
CRC	Displays the CRC code of the power supply controller software.

4.9 Alarm Log

Use this screen to view the DCX RM S power supply alarm history. The alarms can be sorted by alarm number or alarm type. Alarms can be exported to an Excel file.

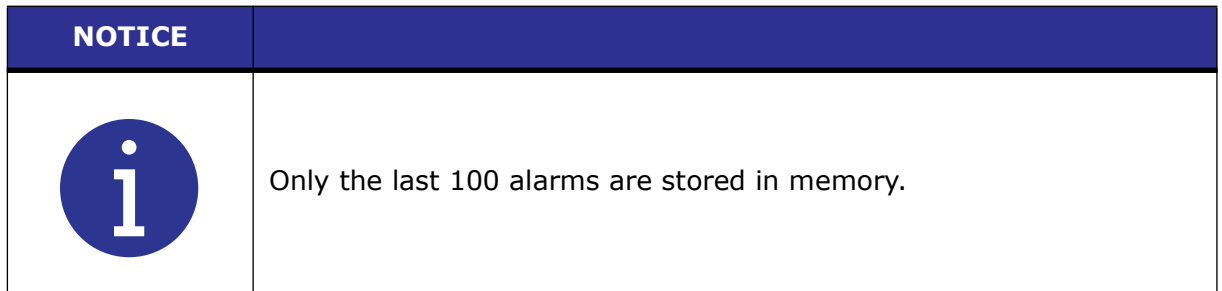


Figure 4.9 Alarm Log Menu

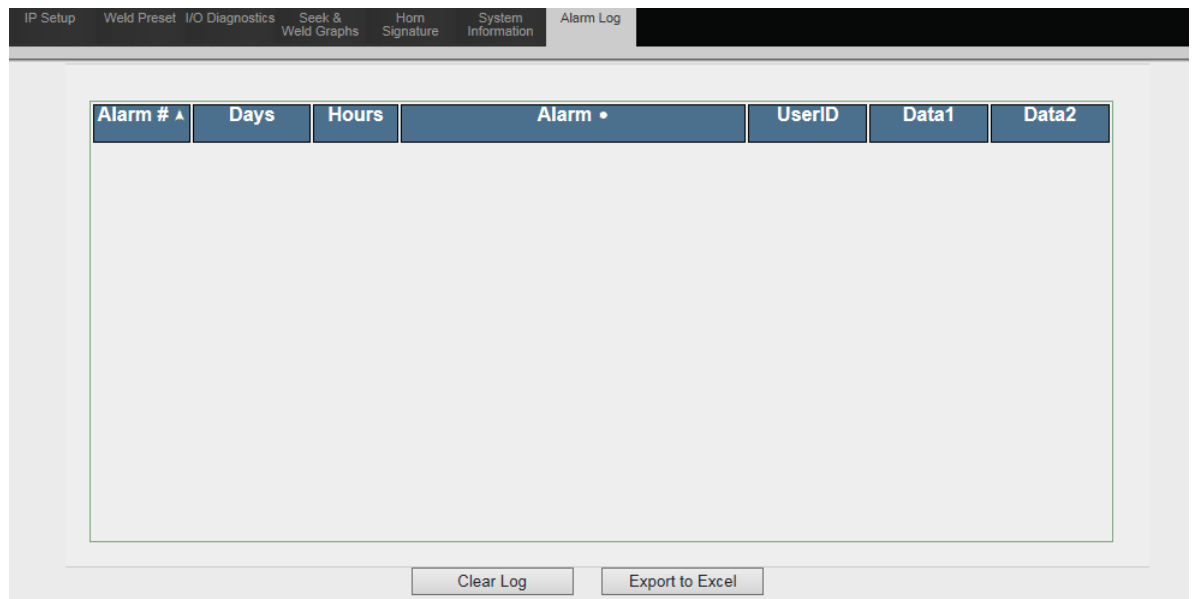


Table 4.8 Alarm Log Menu Option

Name	Description
Alarm #	A unique alarm identification number.
Days	The DCX RM S power supply units do not feature an integrated real time clock. Alarm date and time account for the power-on hours from the moment the DCX RM S power supply was first turned on.
Hours	
Alarm	Displays a brief alarm description.
UserID	The ID number of the user logged in at when the alarm occurred. Will display zero if the alarm occurs from an external weld.
Data1	For future use.
Data2	

Table 4.8 Alarm Log Menu Option

Name	Description
Command Buttons	
Clear Log	Click to clear the alarm log.
Export to Excel	Click to download an Excel spreadsheet file of the alarm log.

Appendix A: Manual's Revisions

A.1 Manual's Revisions 34

A.1 Manual's Revisions

Refer to the table below for the appropriate manual revision depending on your Power Supply's manufacturing date.

Table A.1 Manual's Revisions

Manual's Revisions	Power Supply's Manufacturing Date	
	From	To
00	April 2022	March 2026
01	April 2026	To date

Figure A.1 Manufacturing date on the Information label


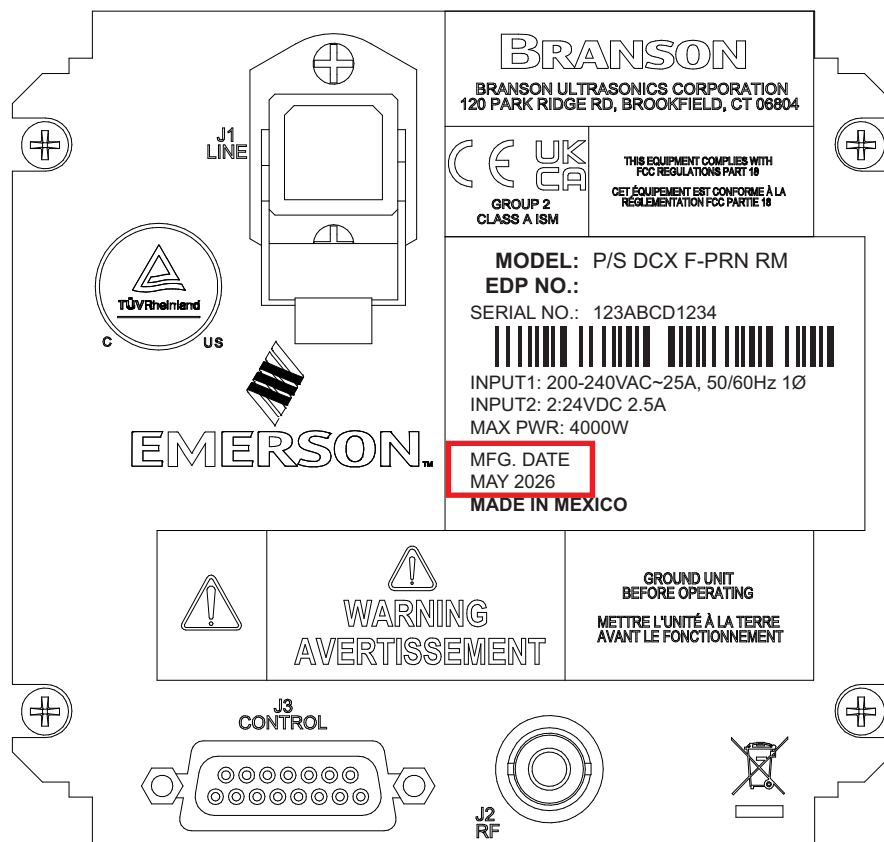


Figure A.2 Location of the Information label on the back of the DCX RM S Power Supply



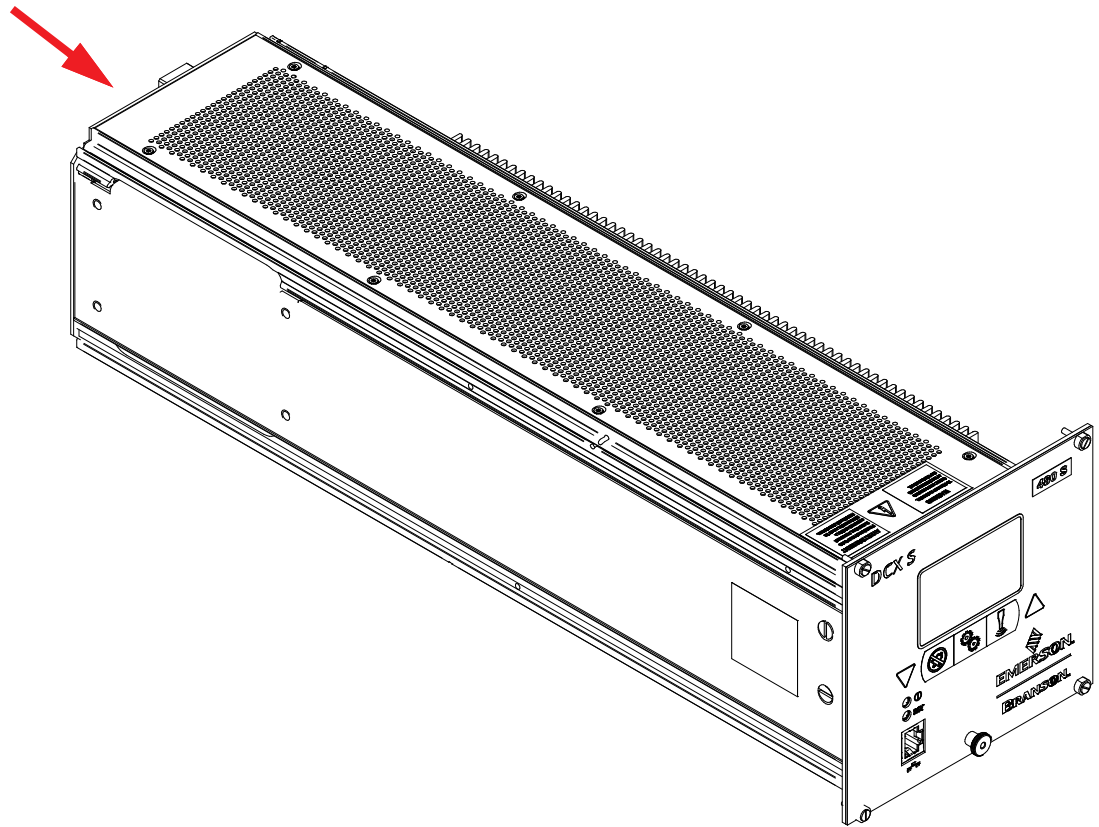

Index

Symbols

+Power (%) 23

A

Abort Horn Scan 29
Alarm 31
Alarm # 31
Alarm Log 31
Alarms - Reset Required 24
Amplitude 23, 27
Amplitude Ramp (ms) 23
Analog Inputs 25
Analog Outputs 25

C

Clear Log 32
Clear Memory before Seek 23
Clear memory with Reset 23
Command Buttons 18, 32
Contact Branson 6
Continuous 22
Controller Version 30
CRC 30

D

Data1 31
Data2 31
Days 31
DHCP Client 21
DHCP Server Enabled 20
Digital Inputs 25
Digital Outputs 25
Digital Tune (Hz) 23
Display 30
Draw from... to... 27, 29

E

Emissions 5
End of Weld Store 23
Energy (J) 22
Ethernet Port 12
Export Graph Data 27, 29
Export to Excel 32
External 23

F

Frequency 23, 27, 30

Frequency Offset (Hz) 23

G

Gateway 20
General Precautions 4
Graph Selection 27, 29

H

Horn Signature 28, 29
Hours 31

I

I/O Diagnostics 25
Intended Use of the System 5
Internal Offset (Hz) 23
Introduction 8
IP Address 20
IP Setup 20

J

J3-1 Peak Power - Plus Limit 25
J3-10 Power Out (V) 25
J3-12 Peak Power - Minus Limit 25
J3-13 External Reset 25
J3-14 Amplitude Out (V) 25
J3-15 Amplitude In (V) 25
J3-2 O/L Inverted 25
J3-4 Overload 25
J3-5 External Start 25
J3-6 External Seek 25
J3-9 Sonics Active 25

L

LCD CRC 30
LCD Software Version 30
Login 19

M

MAC Address 20
Memory 27
Menu Display 18
Menu Navigation Tabs 18
Misc Setup 24
Mode 22
Models Covered 9

O

Off 22, 23
OK - Memory Stored 27
On 22
Overload - Cleared 27

P

P/S Version 30

- Parallel Resonant Points 29
- Peak Power Window 22
- Point to Point Connection 14
- Power 27
 - Power (%) 23
 - Power Level 30
 - Power On 23
 - Power Supply 30

R

- Redraw Graph 27, 29
- Reset Overload 27
- Result 29

S

- Safety and Support 1
- Safety Requirements 2
- Scan 24
- Seek 23, 24, 27
- Seek & Weld Graphs 26
- Seek Ramp (ms) 23
- Seek Time (ms) 23
- Serial Number 30
- Series Resonant Points 29
- Set Default 27, 29
- Start Horn Scan 29
- Static IP 20
- Status 29
- Subnet Mask 20
- Symbols 2
- System 30
- System Information 30
- System Requirements 13

T

- Time (s) 22
- Timed Seek 23

U

- Update Graph 27, 29
- Update Value 27, 29
- UserID 31

W

- Warnings 2
- Web Page Interface 18
- WebSite Version 30
- Weld Amplitude (%) 23
- Weld Preset 22

