


# Laser Welding Technical Information

## How Laser Welding Works

A laser is a beam of concentrated light energy generated at a specific wavelength. In nature, light exists across a spectrum of wavelengths, ranging from very short (X-rays and gamma rays) to very long (radio waves). Humans can only see visible or the “white light” wavelengths from around 430-690 nanometers (nm). A laser beam is an amplified concentration of light energy at a specific wavelength. It is coherent light, which allows focusing on a tight spot and a narrow beam over long distances. The word LASER is an acronym that stands for Light Amplification by Stimulated Emission of Radiation.

### Electromagnetic Spectrum

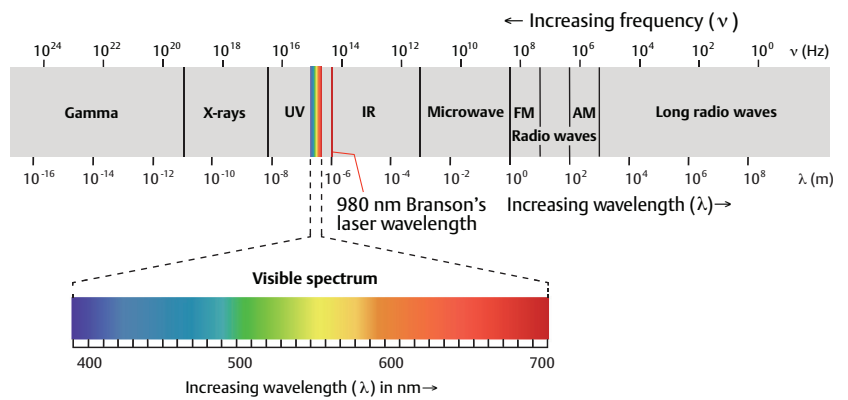


## Laser beams change when interacting with material

Laser energy absorption of a material varies based on a number of factors, such as wavelength, material thickness, crystalline structure, material additives, molecular structure, and more. The process takes the advantages of these material properties and laser to create a bond between two plastic materials—one that transmits the laser energy and one that absorbs it.


When a laser beam encounters any material such as plastic, it will either be transmitted, reflected, or absorbed based on the wavelength and the composition of the material it encounters. Most materials exhibit some degree of all three effects, but in varying proportions. A material may be optically clear to light in the visible spectrum and very absorptive to infrared laser, or be opaque to our eyes but transparent to infrared laser.

## Amorphous vs. Semi-Crystalline


### Amorphous

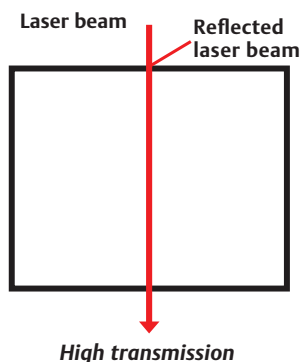


### Semi-Crystalline

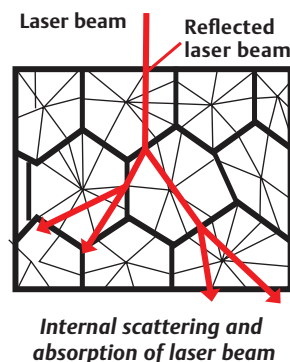


### Laser energy source

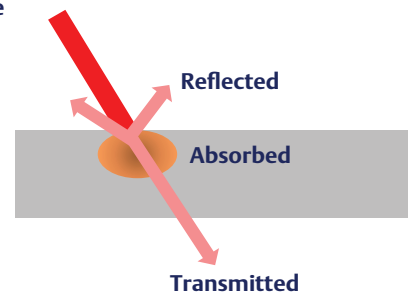

## Laser transmission varies with wavelength

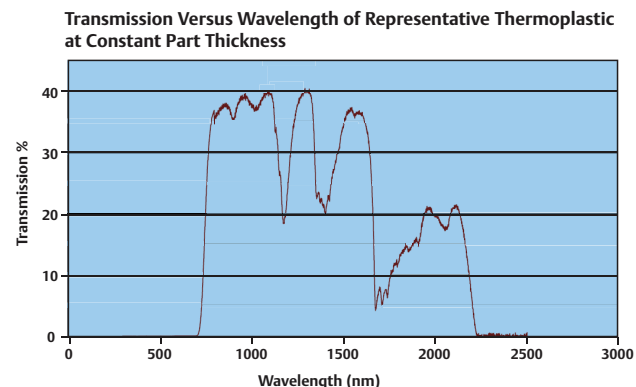

## Laser transparency varies with material thickness

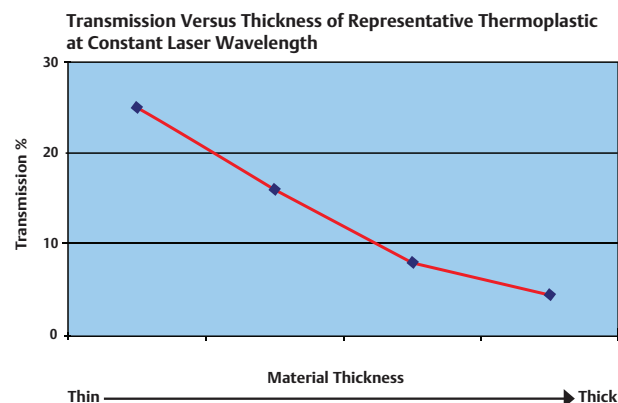

## Compatible Materials

Laser welding can join materials that are not easily welded using other methods. Some of the materials that have been welded successfully to date include:

- Acrylonitrile butadiene styrene (ABS)
- Acrylics
- Cyclic olefin copolymer
- Elastomers (TPU/TPE)
- PBT
- Polyamide
- Polycarbonate (PC)
- Polymethyl methacrylate (PMMA)
- Polyoxymethylene
- Polypropylene (PP)
- Polyphenylene sulfide (PPS)
- Polystyrene (PS)
- Thermoplastic polyurethane
- High-density polyethylene (HDPE)
- Low-density polyethylene (LDPE)
- Polysulphone

**Laser welding is also effective with some dissimilar material combinations.** Research and development teams at material suppliers and universities worldwide have been actively advancing the frontier of plastic laser welding. More laser-compatible materials and additives are being developed, and the possibilities are expanding quickly.

For transmitting parts, the best welding results are obtained when the material transmission rate is 20% or higher. Some applications have been successfully laser welded with a material transmission rate as low as 15%, but this may result in higher process sensitivity. For absorbing parts, black or darker-colored materials (colored with carbon black) are usually very good absorbers.

When combined with high-transmission-rate materials, black or dark-colored parts will usually produce the fastest laser welds. Many shades of gray and beige have also been found to be good absorbers, as well. It is also possible to laser weld two parts that are both optically clear by adding an absorptive interface between the two parts.

The use of fillers, such as glass fiber, must also be taken into account when designing parts for laser welding. The addition of a filler to a resin generally decreases the transmission rate of the material by diffusing or absorbing the laser light as it passes through the part. If the filler content is too high and the transmission thickness is excessive, it may not be possible to generate enough heat at the weld interface to create a weld.

## Methods of Laser Welding

**There are several methods of laser welding:** All methods use similar fundamentals of laser energy and absorptive materials to create heat, melt plastic, and form a bond. However, several of the technologies have significant trade-offs to implementation, or are not ideal for applications.

| Method                                         | Description                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Hybrid Methods                                 | Combinations of trace laser technology with other joining or warming techniques, such as thermal conduction or non-coherent, infrared warming, to counter some of the disadvantages of trace welding.                                                                                                                                                                                                                                                  |
| Mask Wavelength                                | Utilizes a mask to physically block laser energy from reaching some spots, but permits it where the weld is desired. Laser energy can be applied over a large area, or in a line-shaped beam that travels over the mask. This method is very inefficient, wasteful of laser energy on the mask, and slow.                                                                                                                                              |
| Roller or Sphere                               | Laser beam shoots through a transparent roller or sphere, which is in contact with the parts and applies welding pressure. There is risk of marking of the part surface when force is applied at a single point. Weld time scales up with weld-line distance.                                                                                                                                                                                          |
| Semi-simultaneous (a.k.a., Quasi-simultaneous) | A single laser beam is fired at a mirror that rotates on several axes to aim the beam to the parts. The part geometry is restricted to certain angles facing the mirror, and the weld line is typically a closed loop.                                                                                                                                                                                                                                 |
| *Simultaneous STTlr                            | Uses one or more laser beams to melt the entire line simultaneously. Beams can be shaped in positive or negative waveguides to create 3-D solutions. This is the best method for large parts and mass production.                                                                                                                                                                                                                                      |
| Trace                                          | A single laser beam travels along the weld line. Weld time scales up with weld distance, and weld depth is not easy to control. High local intensity can lead to burns.                                                                                                                                                                                                                                                                                |
| 2 $\mu$ m Wavelength                           | Lasers of different wavelengths can be used. At 2 $\mu$ m, most materials tend to be absorptive and exhibit volumetric heating throughout the parts. Both upper and lower parts will melt. This process can weld two clear parts, but is generally limited to thin components and 3-D applications prove extremely challenging. A 2 $\mu$ m, simultaneous welding solution does not exist, so this process is typically slower as the part size grows. |
| Wide-beam Scan                                 | Similar to mask in using physical barriers, but utilizes a waveguide to direct the laser energy. Unlike the mask method, wide beam scan directs most of the energy to the weld line, and is typically much faster.                                                                                                                                                                                                                                     |

*\*Branson has dedicated 15 years toward developing and refining the STTlr process to overcome the limitations of trace, semi-simultaneous, and roller/sphere welding. The STTlr's waveguide can be applied as simultaneous or wide-beam scan methods.*

## STTir® Laser Welding is a Fast, Four-Step Process


Simultaneous Through-Transmission Infrared® (STTir) laser welding is a process developed and patented by Branson. Waveguides direct and distribute laser energy simultaneously and homogeneously along the weld line.

When two component plastic parts need to be joined, laser welding employs four basic steps to accomplish the task.




**The STTir is the ideal solution for welding parts with three-dimensional weld lines quickly in high-volume production.**

**The waveguide directs the laser energy for homogeneous distribution along the welding line.**

Welding line without waveguide


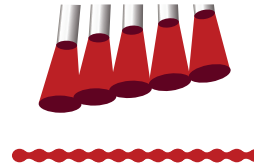


Welding line with waveguide

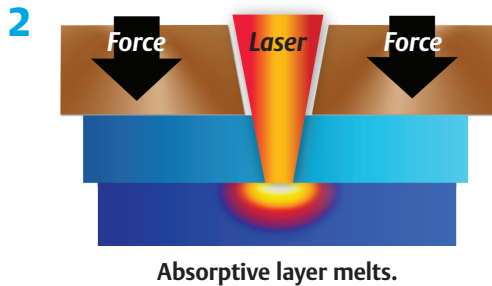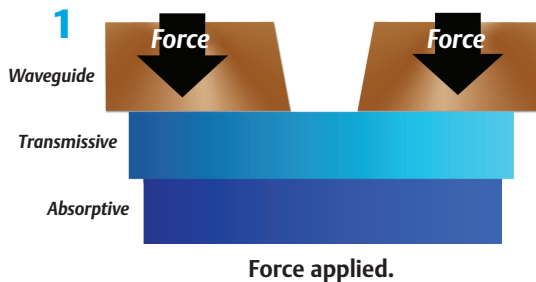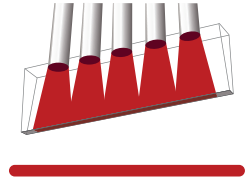

**1** As two component parts are brought together under a specific force, a beam of laser light is generated by the laser welder at a tuned wavelength. The laser beam passes through the transmissive material of one component and is absorbed by the absorptive material of the component to be joined.

**2** When the laser light strikes the absorptive material, it is absorbed and converted to heat, which begins melting the absorptive part in a controlled, precise location.

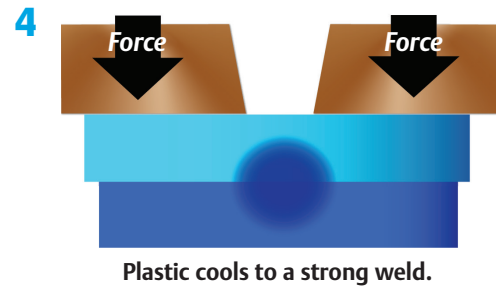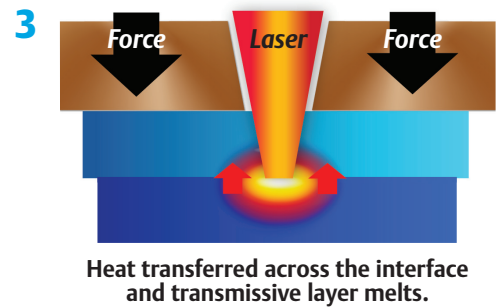

**3** As the absorptive component heats up, the heat conducts across the interface, heating and melting the transmissive component as well. The length of time the laser fires is predetermined by either a set time or by a specified melt depth.

**4** When the laser is turned off, the plastic materials of both the transmissive and the absorptive components cool and solidify, which creates a strong chemical bond.


## Branson Patented Simultaneous Laser Welding

In Branson's process, a tool houses multiple optical fibers in ferrules, which distribute energy across the entire length of the weld line simultaneously. The Branson STTlr simultaneous method produces weld times of 0.5 to 5 seconds. It is the ideal way to weld large parts and/or achieve mass production throughput. STTlr is "contact-less," and no welding machine parts make contact at the weld line. (Force is applied to hold the parts together, but this can be on non-critical surfaces or protected from scratching.) Ferrules can be angled and waveguides can bend light to enter on any axis, providing full 3-D flexibility in design. Laser beams can be shaped to also produce radial welds. With radial tools, pressure is applied on one axis while the laser beam enters on another plane.

**Absorptive part converts laser to heat, heat conducts across interface to melt both parts.**



Please refer to the Branson Tooling Brochure for more information.

### Laser Welding Process

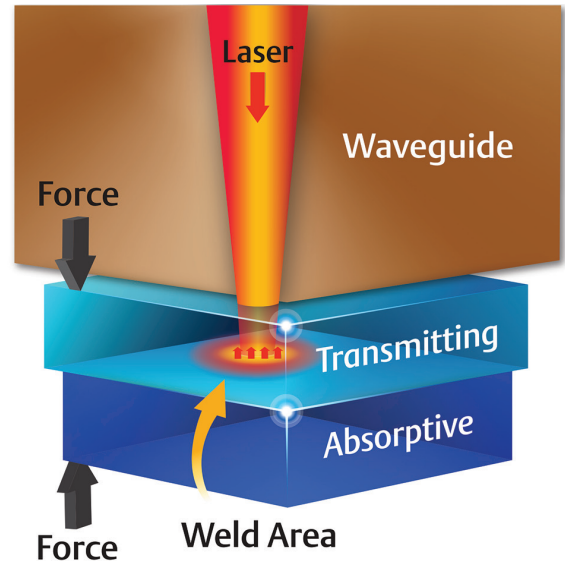

## Alternate Configurations


### Radial Weld

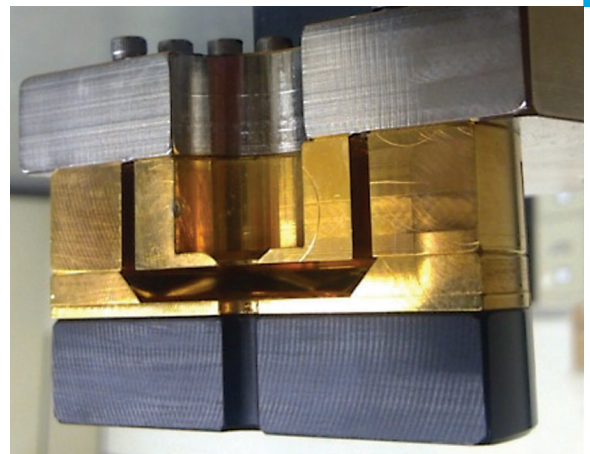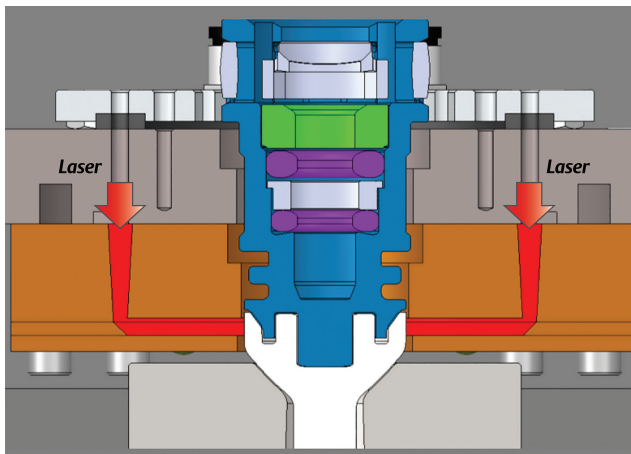

With radial tools, pressure is applied on one axis while the laser beam enters on another plane.

## Wide-beam Scan



Wide-beam Scan welding is another method that is used when welding of larger surface areas is desired. With this method, a curtain of laser light is projected down onto the clamped part set. The part set is then traversed through the laser beam and the weld is produced. This method is used when limited collapse and minimal flash are required, as when welding thin films to rigid components.

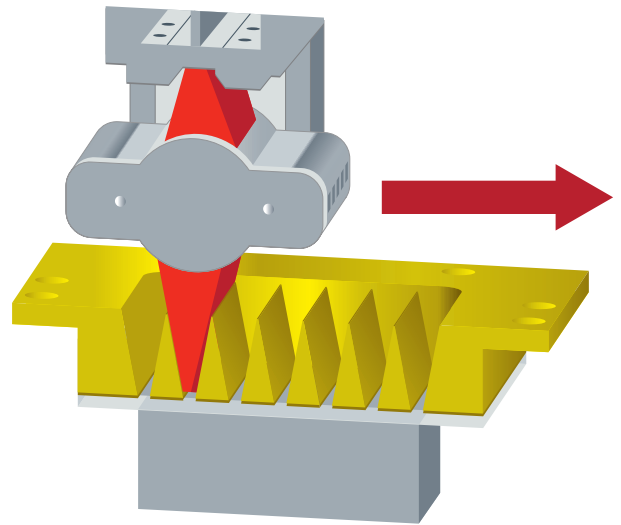

## Positive and Negative Waveguides

The waveguide is an essential, patented component of the STTlr welding machine. It directs and shapes the laser beam from the fiber bundles to the part. Branson's STTlr process can use waveguides of two types: positive and negative.

Positive waveguides use solid material, usually a resin, to transmit the laser energy through the tool and to the part. Although less expensive, positive waveguides can exhibit material degradation over time.

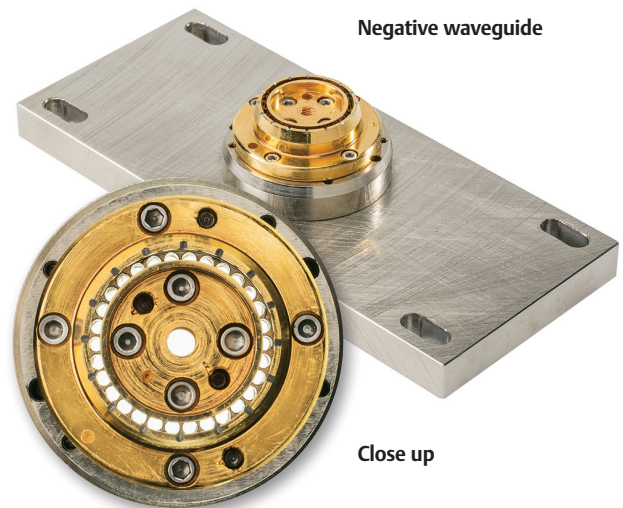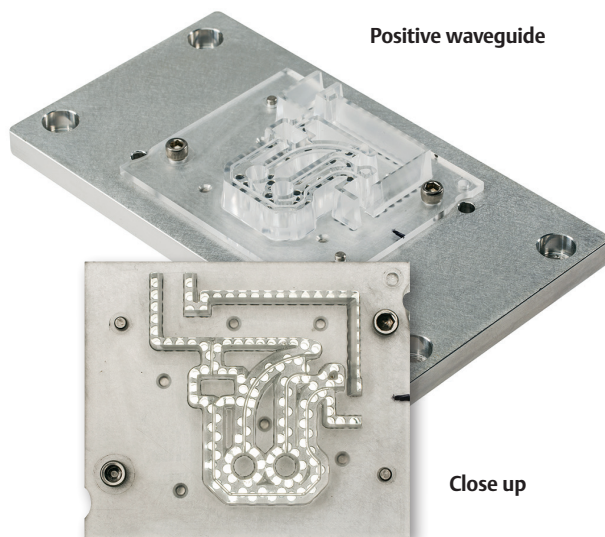

Negative waveguides are typically made of metal, and direct laser energy through an open cavity to the parts. Negative waveguides are durable and robust, and have been proven to perform consistently over years of high-speed mass production. To maximize the efficiency of the negative waveguide, a gold coating can be applied, which reflects the laser. These types of waveguides tend to cost more but could be more cost effective than positive waveguides over long-term use.

## The Advantages of Branson Laser Welding

### Weld Quality

Because the process is non-intrusive, the parts typically exhibit excellent cosmetic properties. The heating/melting of the parts is very localized, occurring only at the weld interface.

### Minimal Flash and No Particulate

Since the process can be easily controlled by varying the power of the laser source, it is possible to accurately control the power dissipation within the weld, resulting in less flash. There is also no frictional motion between the parts and therefore no particulate generated.

### Part Design Flexibility

This method allows for 3-D joint configurations, and is unrestricted with respect to a common weld plane. Many internal weld lines are possible.

### Gentle to Sensitive Assemblies

Since there is little movement of the parts, no excitation or vibration, sensitive electronic and mechanical assemblies can be welded without damage. Only a clamping force to hold the two parts being welded is needed.


### Fast and Flexible

Ideal for high-volume applications; a typical weld cycle ranges from 0.5 to 5 seconds.

Automotive



Medical

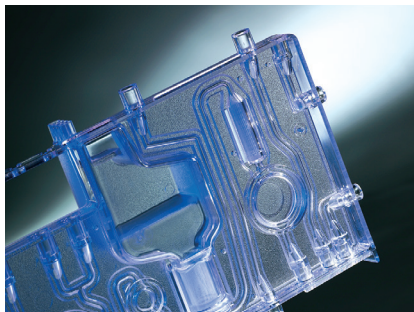


Business & Consumer Electronics



## Branson Laser System Architecture

A laser bank contains five diodes that generate the laser energy, with closed loop feedback. The energy travels from the bank to the upper tool in flexible, highly purified optical glass fiber bundles. The upper tool directs the laser energy to the part through waveguides. A lower tool holds the part. Force can be applied either from the upper or lower tool, depending on the application and machine configuration. Other components, such as a chiller, human/machine interface, and power supplies are typically located in a different part of the system, or laser support unit.

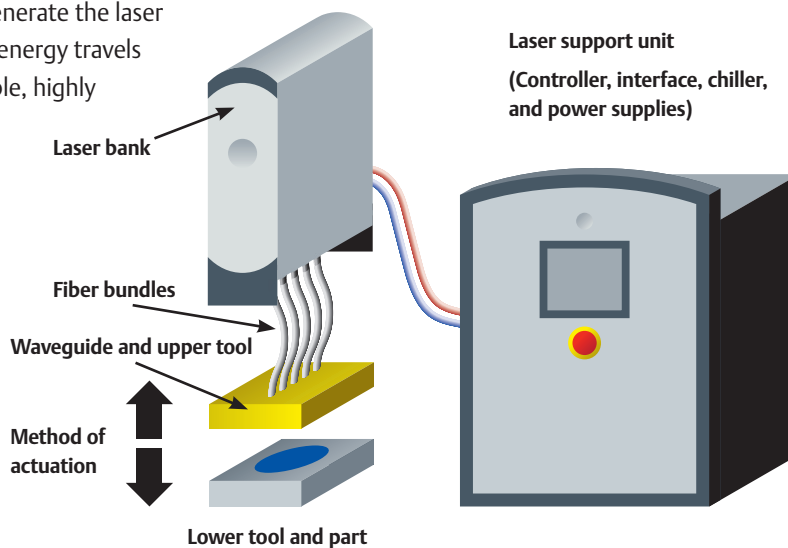

## ***True Global Support & Service***

Branson is committed to not only engineering and supplying laser welding equipment to meet your needs, but also to providing applications support, employee training, troubleshooting, and ongoing customer service so that your equipment continually operates as expected.

Branson laser equipment is backed by our proven commitment to providing superior global technology, support, and customer service through a worldwide network of 70 offices. Branson, a business of Emerson, is a diversified international manufacturing and technology company committed to developing technological breakthroughs that enhance the performance of a wide range of products and processes.

***To learn how Branson's expertise can help you adapt to industry changes, contact the regional center nearest you.***

### **Americas**

Branson Ultrasonics Corp.  
41 Eagle Road  
Danbury, CT 06810, USA  
T: 203-796-0400  
F: 203-796-0450  
[www.bransonultrasonics.com](http://www.bransonultrasonics.com)

### **Europe**

Branson Ultraschall  
Niederlassung der Emerson  
Technologies GmbH & Co. OHG  
Waldstrasse 53-55  
63128 Dietzenbach, Germany  
T: +49-6074-497-0  
F: +49-6074-497-199  
[www.branson.eu](http://www.branson.eu)

### **Asia**

Branson Ultrasonics (Shanghai) Co., Ltd.  
758 Rong Le Dong Road  
Song Jiang, Shanghai, PRC, 201613  
T: 86-21-3781-0588  
F: 86-21-5774-5100  
[www.branson.com.cn](http://www.branson.com.cn)